




Deze download wordt u gratis aangeboden door Pick-upnaalden.nl

Web : www.pickupnaalden.com
Email : info@pick-upnaalden.nl
Facebook : www.facebook.com/pickupnaalden
Twitter : twitter.com/Pickupnaalden
Google+ : https://plus.google.com/+FCaris_pickupnaalden

Service
Service
Service

Service Manual

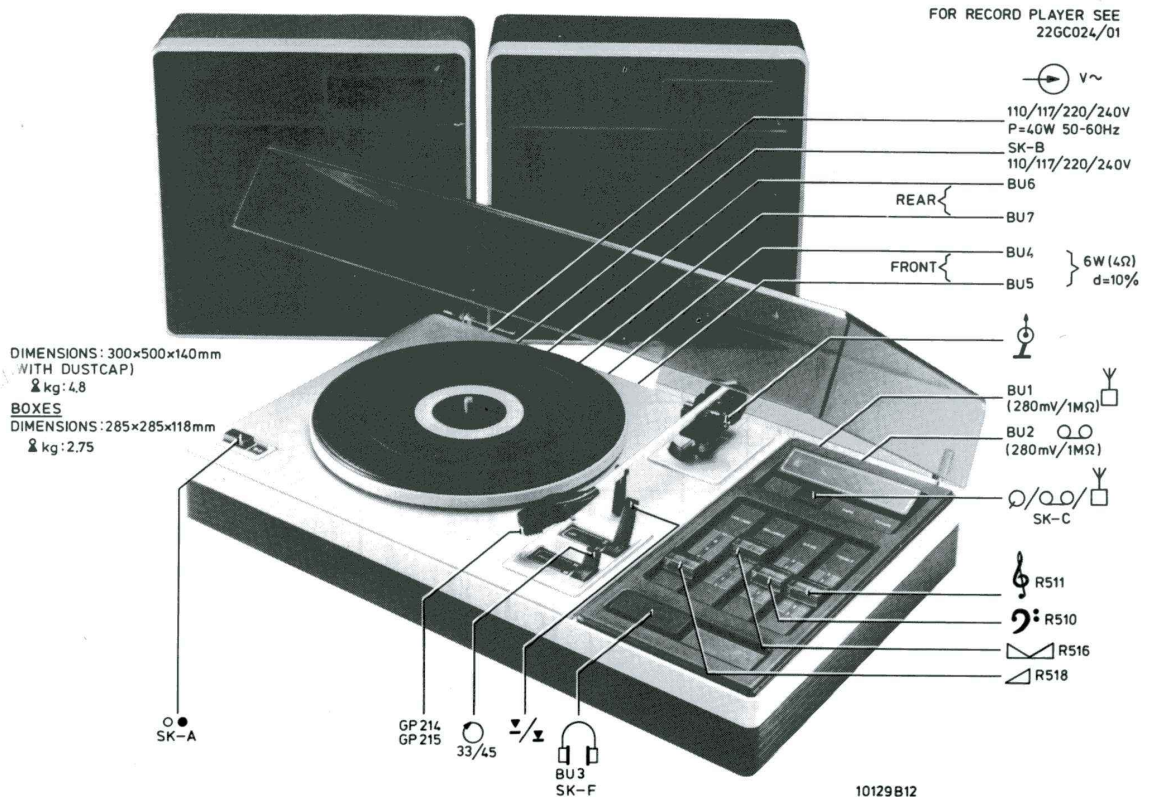

Safety regulations require that the set be restored to its original condition and that parts which are identical with those specified, be used.

Documentation Technique Service Dokumentation Documentazione di Servizio Huolto-Ohje Manual de Servicio Manual de Servicio



Subject to modification

4822 726 11789

Printed in The Netherlands

PHILIPS


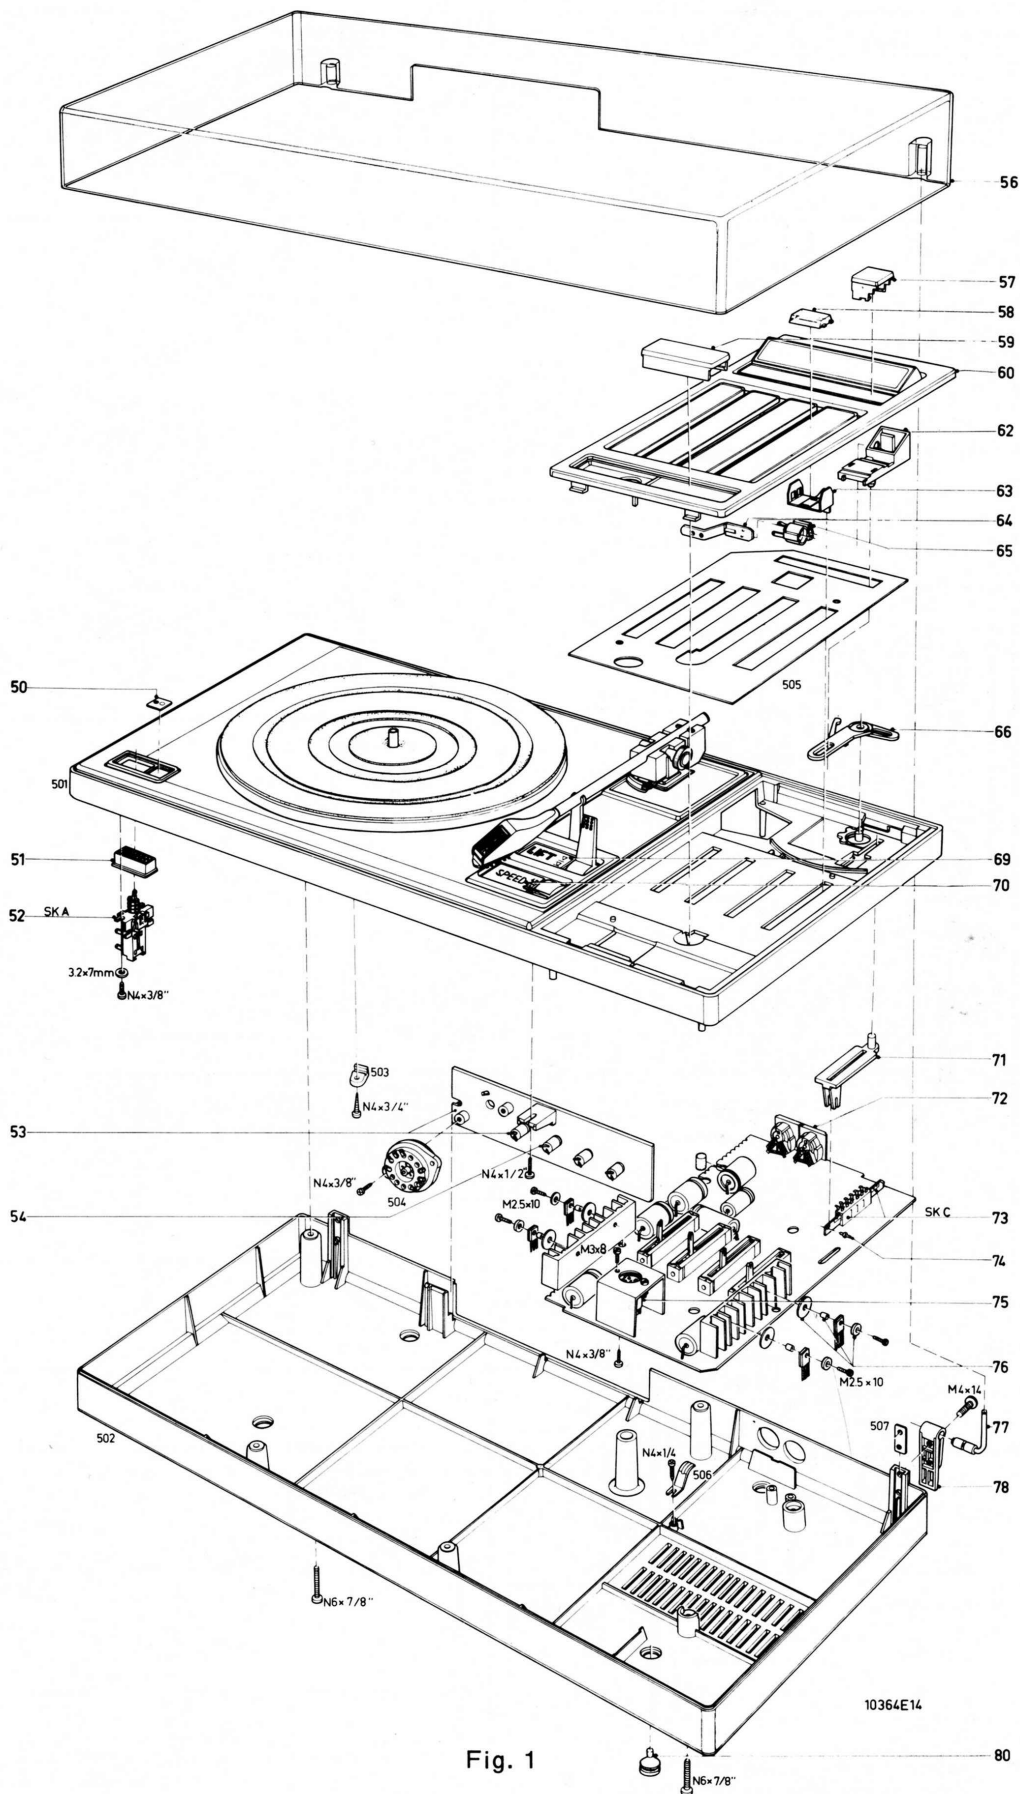


Fig. 1

50	4822 454 30252	62	4822 402 60476	74	4822 535 90892
51	4822 410 21786	63	4822 402 50135	75	4822 267 40192
52	4822 276 10519	64	4822 402 60477	76	4822 255 40115
53	4822 268 30043	65	4822 255 10007	77	4822 417 10543
54	4822 268 20032	66	4822 402 50133	78	4822 417 10545
56	4822 444 20177	69	4822 454 30254	80	4822 462 40227
57	4822 411 60346	70	4822 454 30253		
58	4822 381 10417	71	4822 402 50134		
59	4822 411 60386	72	4822 267 40209		
60	4822 459 80069	73	4822 277 30571		

IC451.TS402a			SK-E, M		SK-D		TS403a...405a		D479a, 478a		TS407a...410a				BU3		BU4		BU6		MISC			
TS402b							D474, 475 TS403b...405b		D479b, 478b		TS407b...410b				SK-C		SK-F		BU5		BU7		MISC	
a	616a	609a	617a 610a		611a		612a		613a						618a 615a								C	
b	616b	609b	617b 610b		611b		685 612 b		613b 681		614a		682		614b 684		618b 618b						C	
512a	515a, 566...570, 516a		529a 517a		518a		519a 520a		522a		531a		523a...526a		530a		532a						C	
512b	515b		516b 529b 517b		518b		519b 520b		522 b		521a, b 531b		523b...526b 581		530b		532b		597				R	
																								R
																								R

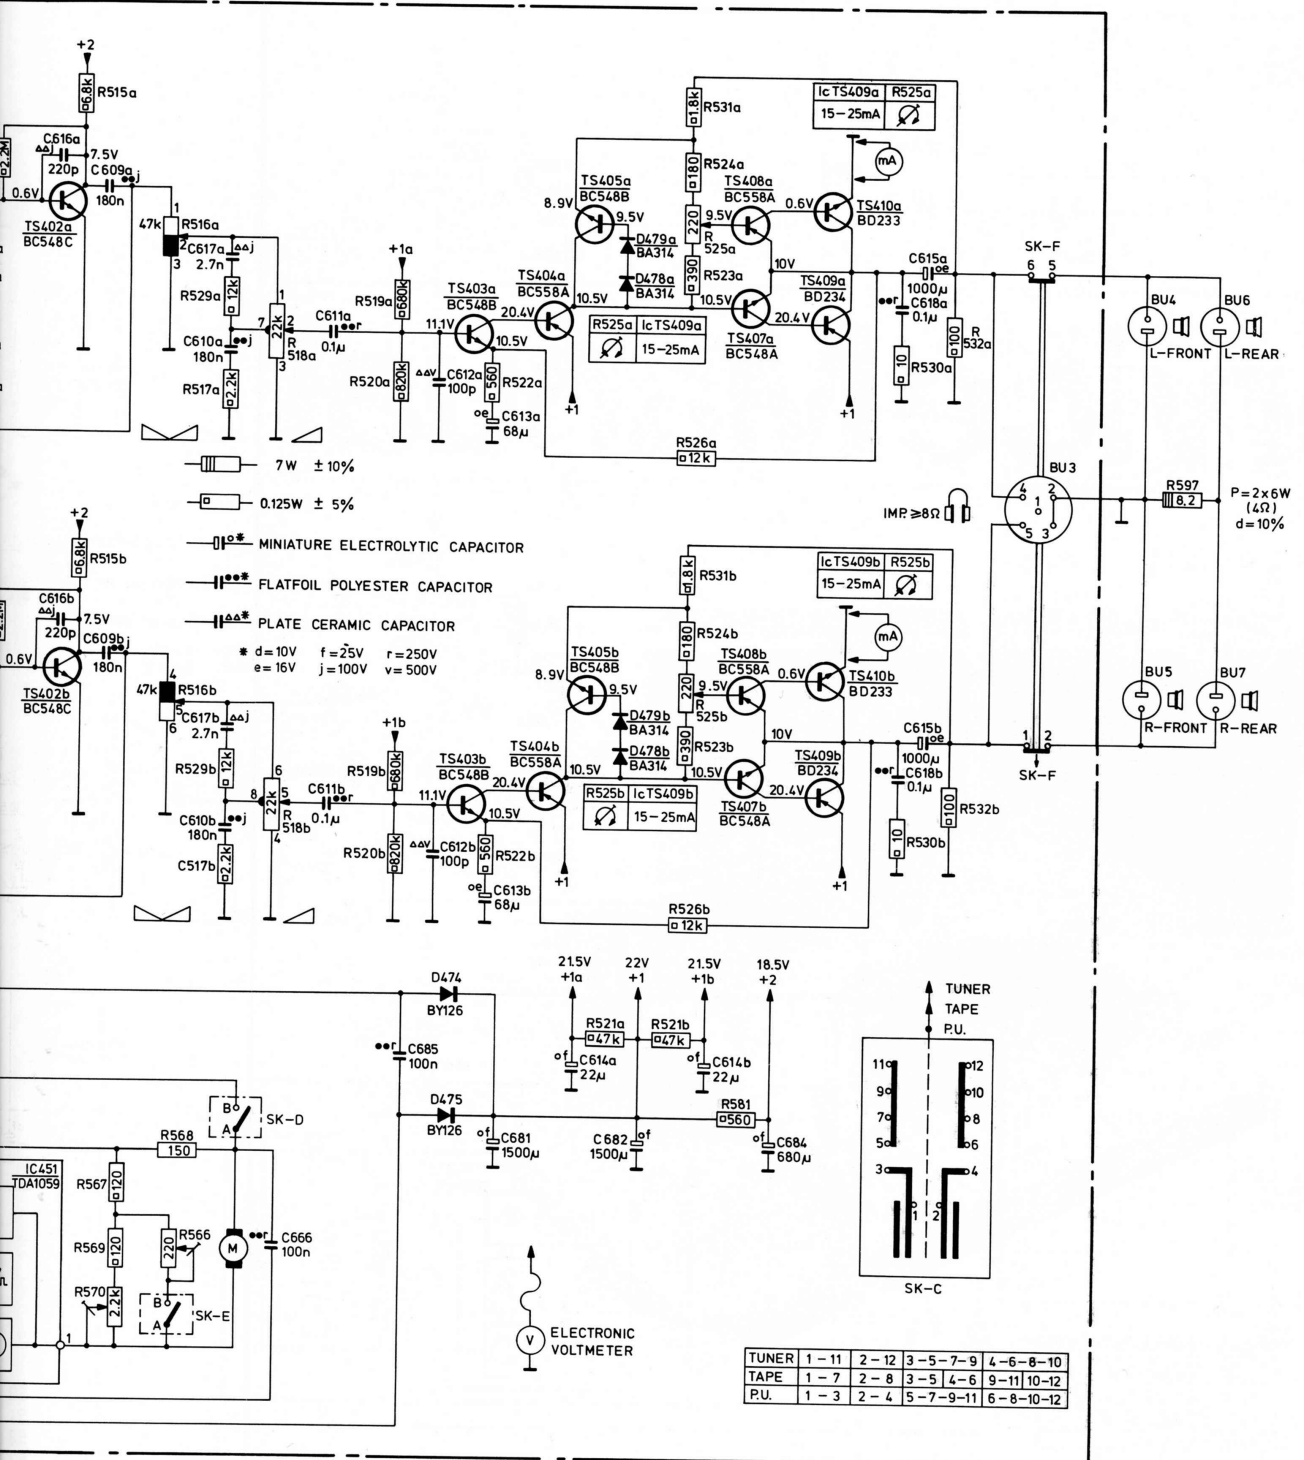

MISC.	BU1		SK-C		TS401a,LA496						IC451,TS402a						SK-E, M		SK-D					
MISC.	BU2		SK-A	SK-B	F462		T468		TS401b		D477		TS402b						D					
C									601a	602a	603a	604a	606a	605a	607a	608a	616a	609a	617a	610a	611a			
C									601b	602b	603b	604b	606b	605b	607b	608b	616b	609b	617b	610b	611b	685		
R			504a, b		501a	502a	505a		506a	507a	510a	513a	509a	508a	511a	514a	512a	515a, 566	570, 516a	529a	517a	518a	519a	520a
R			503a, b		501b	502b	505b		506b	507b	510b	513b	509b	508b	511b	514b	512b	515b	516b	529b	517b	518b	519b	520b

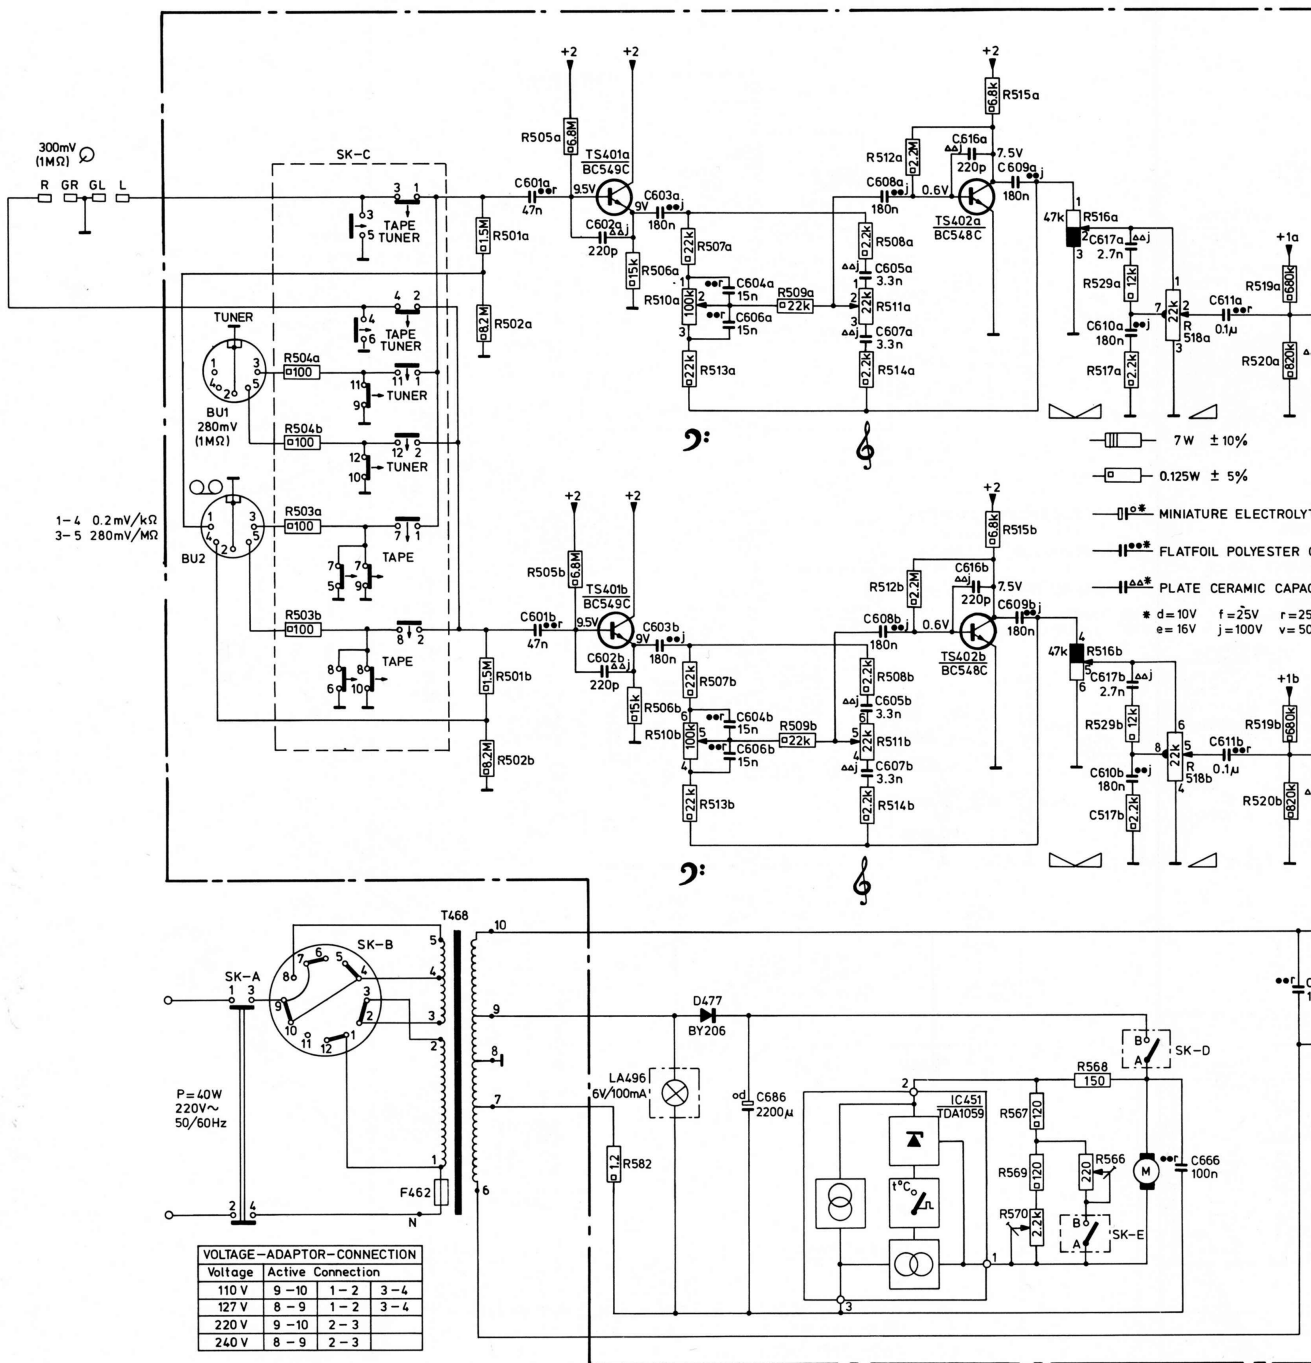


Fig. 2

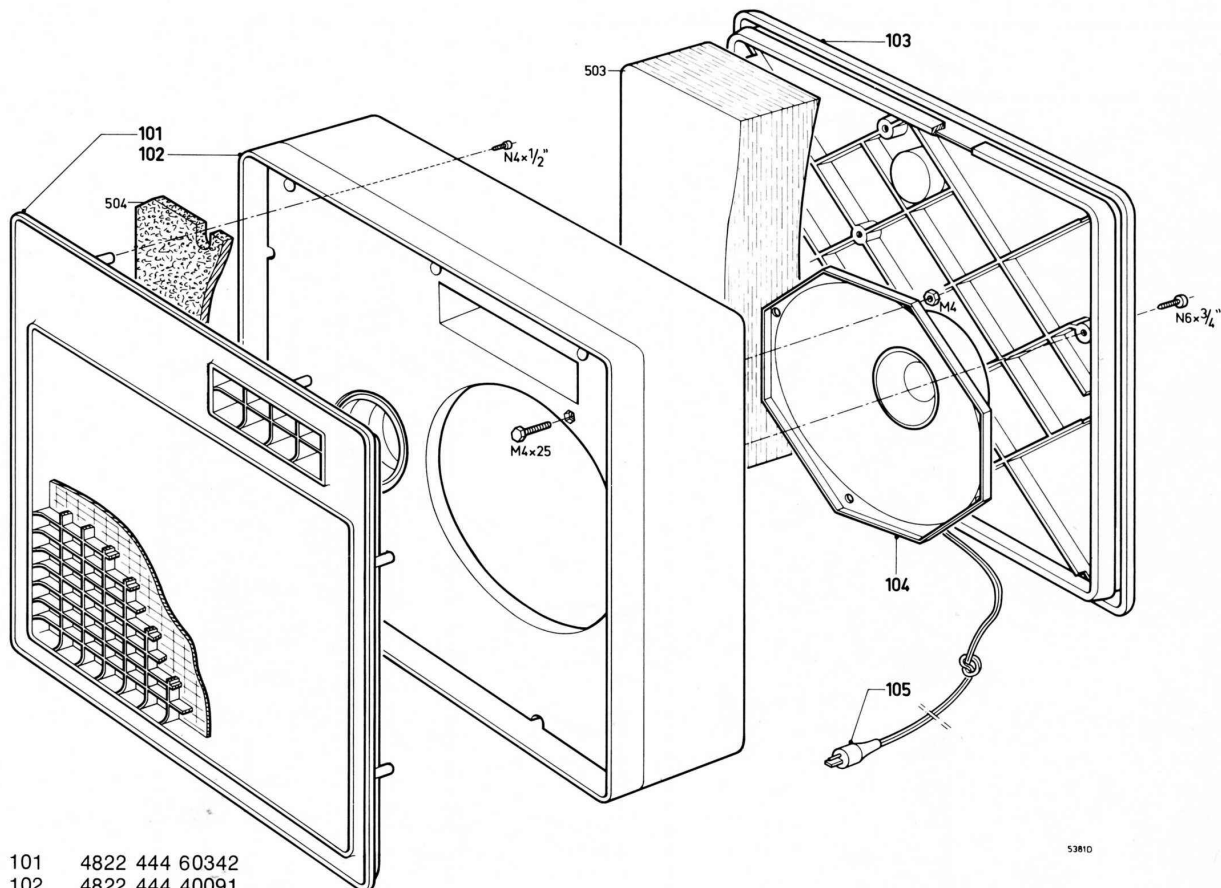


Fig. 4

101 4822 444 60342
 102 4822 444 40091
 103 4822 444 50258
 104 4822 240 50094
 105 4822 264 30041

-TS- 			-Miscellaneous-		
401a-401b	BC549C	5322 130 44246	M	Motor	4822 361 20131
402a-402b	BC548C	5322 130 44196	462	Trafo fuse	4822 252 20071
403a-403b }	BC548B	4822 130 40937	468	Trafo	4822 145 40158
405a-405b }			469	Lamp 6 V - 100 mA	4822 134 40326
404a-404b }	BC558A	4822 130 40962	-R- 		
408a-408b }					
406a-406b }	BC548A	4822 130 40948	510a,b	2x100 kΩ (lin)	4822 105 10136
407a-407b }			511a,b	2x22 kΩ (lin)	4822 105 10135
409a-410a }	BD234/233 pair	4822 130 41017	516a,b	2x47 kΩ (lin)	4822 105 10188
409b-410b }			518a,b	2x17 K + 5 kΩ	4822 105 10189
451 }	I.C. TDA1059	4822 209 80321	525a-525b }	Trimptm. 220 Ω	4822 100 10019
-D- 			566		
			568	150 Ω 1/8 W 2%	5322 116 54486
474-475	BY126	5322 130 30192	570	Trimptm. 2k2 Ω	4822 100 10029
477	BY206	4822 130 30839	597	8E2 7 W	4822 112 41052
478a-478b }	BA314	4822 130 30879			
479a-479b }					

